Reach Plus Single

Contents

x1 | x1 | x1 | x1 | x1 | x1

x1 | 4x M4x12 / 4x M4X16 | 2x M8X20 | 2.5mm x1 | 4mm x1 | 6mm x1

8mm x1

Dimensions

Designed to fit onto desks with 19-30mm thickness with the included clamp.


153mm
320mm
520mm
55mm
127mm
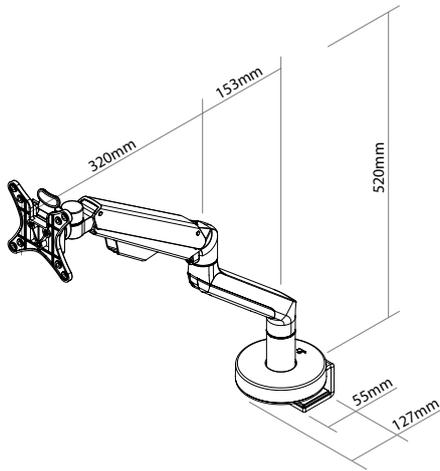
Mounting the base to the desk

Use the supplied M8x20mm grub screws in the clamp if more thread is required
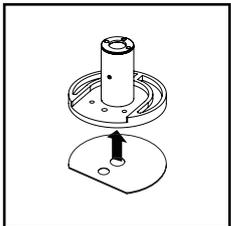
Ensure the EVA pad is applied to the bottom of the base to protect the desk surface.

Add pad to clamp if required
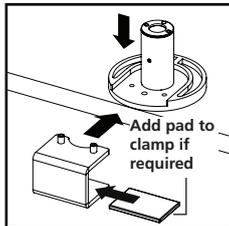
Place base on desk with recess facing the edge. Offer up the clamp to the base as shown.
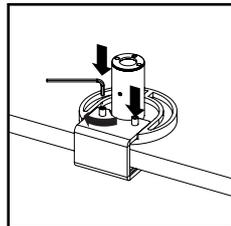
Use 4mm Allen key to tighten the 2x grub screws in the clamp into the base.

Nylon bush in no lockout position
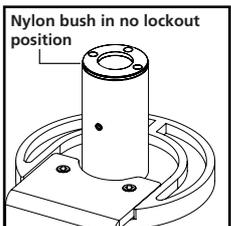
The nylon bush can be removed, flipped and refitted to remove/apply the 180° lockout.

Nylon bush in 180° lockout position
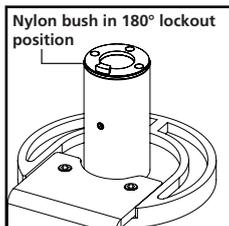
Flip the bush over so the protrusion faces upwards to apply the 180° lockout as shown.
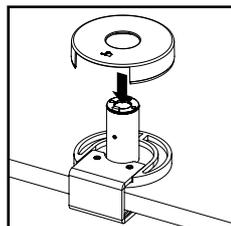
Place the clamp cover over the base with the recess facing the desk edge. No fixing required.
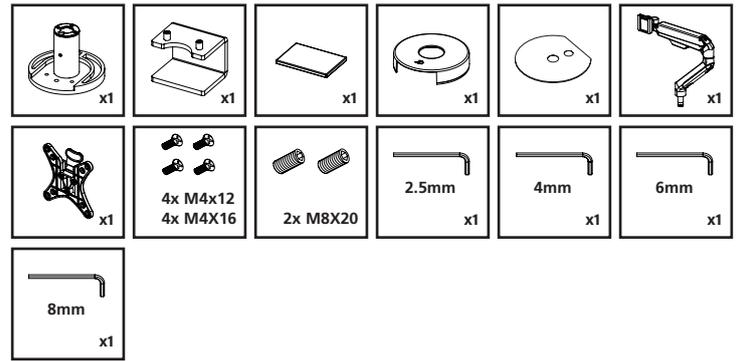
Installing the arm
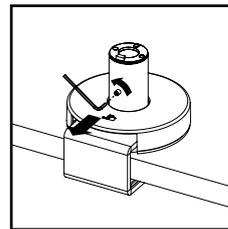
Use 2.5mm Allen key to loosen grub screw and allow arm assembly to drop into base stem.
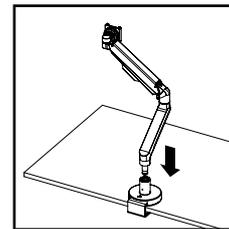
Carefully insert the pin at the bottom of the arm assembly into the base stem.
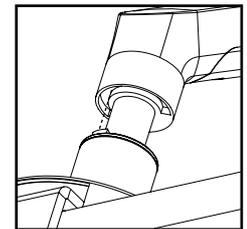
If 180° lockout is required, ensure bush protrusion sits in recess at bottom of the arm.
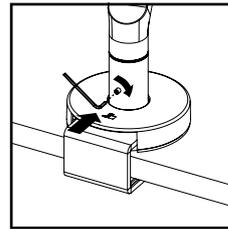
Tighten the grub screw to secure the arm assembly to the base. Do not overtighten.
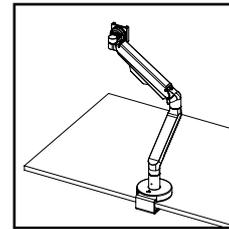
The arm is now fully assembled and ready for the monitor to be installed.

Installing a monitor
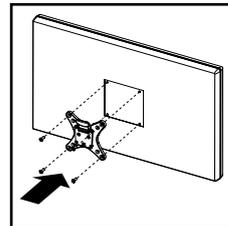
Offer up the quick release VESA to the rear of your monitor, ensure lever is at the top.
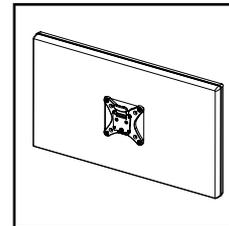
Fix in place with supplied fixings. 4x M4x12/16mm CSK pozi screws.
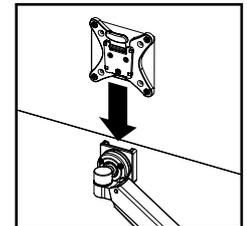
Align the raised square section on the VESA with the recess on the head mount.
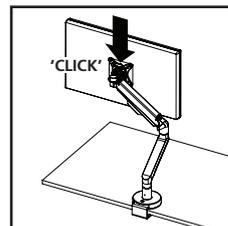
'CLICK'

Lower the monitor onto the head mount until it clicks into place.

cmd

Removing a monitor
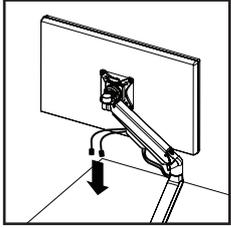
Disconnect any cables from the monitor.
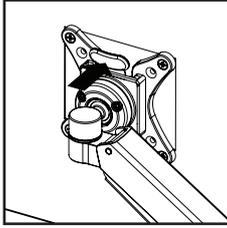
Depress the lever at the top of the VESA to release it from the head mount.
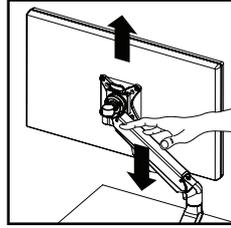
The arm may try to spring up as the weight is removed. Guide the arm to prevent this.
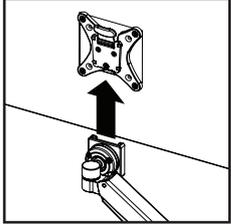
Carefully lift the monitor up and away from the arm.

Cable management
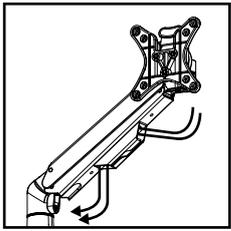
Feed the cables through the built in cable clip on the upper arm assembly as shown.
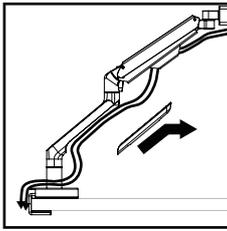
Remove the plastic cover on the lower arm assembly by sliding it up and away from the arm.
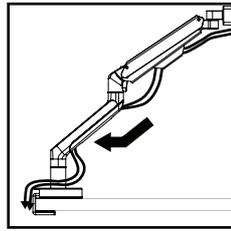
Position the cables inside the cover and slide back into place on the arm.

Arm adjustment
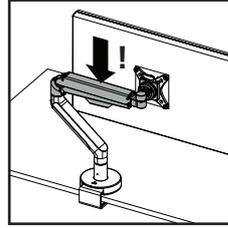
Ensure the upper arm is held down parallel to the desk before making adjustments.
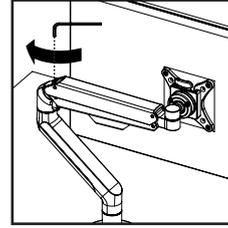
Use 6mm Allen key to turn bolt clockwise for lighter monitors. Guide the arm with free hand.
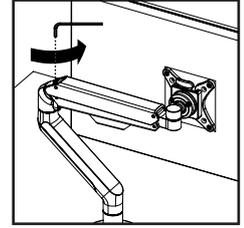
Turn the bolt anti-clockwise for heavier monitors.Guide the arm with free hand.

Additional monitor adjustment
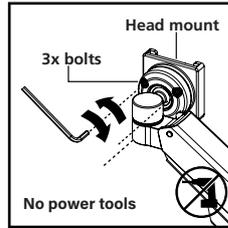
For further adjustment, use the supplied 4mm Allen key to loosen or tighten the 3x bolts.
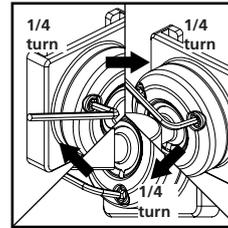
Bolts must be tightened equally, alternating between each until they are all fully tightened.

Supported load
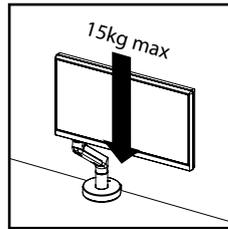
The load range for this monitor arm is from 6kg to a maximum of 15kg.

Additional information

Safety

- Fix the clamp of the monitor arm to a suitable solid worksurface that is capable of supporting the arm and maximum loading of 15kg.
- Product to be used only for the intended purpose of supporting certain display equipment in an office environment.
- Installation is to be carried out in accordance with relevant Health & Safety regulations and only to be carried out by a skilled or competent person.
- The installation should be installed to comply with the relevant national standards and be inspected and tested prior to being put into service (in the UK BS 7671 Wiring Regulations or BS 6396 Office and Educational Systems Best Practice).
- Isolate the supply before installation or repositioning. Any locking mechanisms must be used and fully engaged.
- Do not misuse, dismantle or re-configure the product because doing so will invalidate the warranty.

Standards

- Refer to the Declaration of Conformity.

Product care

- To maintain the longevity of the arm's gas strut and correct function, regularly adjust the arm through it's range of motion when possible.
- Clean using a dry cloth. No abrasives or solvents to be used on the product.
- Do not drop or expose to moisture.